



Neilson Research Corporation
245 S Grape St
Medford, OR 97501
TEL: (541) 770-5678 FAX: (541) 770-2901
Website: www.nrclabs.com

December 18, 2024

Teresa Coley
Sprague River Water Quality Lab
5671 Sprague River Road
Chiloquin, OR 97624
TEL: (541) 827-5231
FAX

RE: RES-Yurok

Order No.: 24120238

Dear Teresa Coley:

Neilson Research Corporation received 13 sample(s) on 12/5/2024 for the analyses presented in the following report.

The results relate only to the parameters tested or to the sample as received by the laboratory. This report shall not be reproduced except in full, without the written approval of Neilson Research Corporation. If you have any questions regarding these test results, please feel free to call.

Sincerely,
Neilson Research Corporation

Tamra Schmedemann
Senior Project Manager
245 S Grape St
Medford, OR 97501



Original



**NEILSON
RESEARCH
CORPORATION**

*Neilson Research Corporation
245 S Grape St
Medford, OR 97501
TEL: (541) 770-5678 FAX: (541) 770-2901
Website: www.nrclabs.com*

Case Narrative

WO#: **24120238**

Date: **12/18/2024**

CLIENT: Sprague River Water Quality Lab

Project: RES-Yurok

The analyses were performed according to the guidelines in the Neilson Research Corporation Quality Assurance Program. This report contains analytical results for the sample(s) as received by the laboratory.

Neilson Research Corporation certifies that this report is in compliance with the requirements of NELAP. No unusual difficulties were experienced during analysis of this batch except as noted below or qualified with data flags on the reports.

Original



Neilson Research Corporation
 245 S Grape St
 Medford, OR 97501
 TEL: (541) 770-5678 FAX: (541) 770-2901
 Website: www.nrclabs.com

Analytical Report

WO#: 24120238
 Date Reported: 12/18/2024

CLIENT: Sprague River Water Quality Lab
Lab ID: 24120238-01
Client Sample ID: 4120403-01
Project: RES-Yurok
Sample Location: Comp

Collection Date: 12/3/2024 10:09:00 AM
Received Date: 12/5/2024 10:20:00 AM
Matrix: AQUEOUS

Analyses	Method	NELAP Status	Result Qual	DF	MDL	RL	Units	MCL	Date Analyzed	Analyst
DISSOLVED TRACE METALS										
Aluminum, Dissolved	E200.7	A	0.0189 J	1	0.00895	0.0200	mg/L		12/10/24 14:01	CBB
TRACE METALS BY EPA 200.7 ICP										
Aluminum	E200.7	A	0.136	1	0.00895	0.0200	mg/L		12/10/24 15:55	CBB
DISSOLVED ORGANIC CARBON BY SM 5310 C-2014										
Organic Carbon, Dissolved	A5310C	A	1.56	1	0.192	0.500	mg/L		12/05/24 18:16	KN
TOTAL ORGANIC CARBON SM 5310 C-2014										
Organic Carbon, Total	A5310C	A	1.76	1	0.142	0.500	mg/L		12/06/24 0:02	KN

QUALIFIERS

C1	Sample container temperature is out of limit as specified at testcode	E	Value above quantitation range
H	Holding times for preparation or analysis exceeded	J	Analyte detected below quantitation limits
MI	Recovery outside control limits due to Matrix Interference	ND	Not Detected at the Reporting Limit
PL	Permit Limit		

Original

NELAP

NELAP A Accredited in accordance with NELAP ORELAP 100016, OR-028



Neilson Research Corporation
 245 S Grape St
 Medford, OR 97501
 TEL: (541) 770-5678 FAX: (541) 770-2901
 Website: www.nrclabs.com

Analytical Report

WO#: 24120238
 Date Reported: 12/18/2024

CLIENT: Sprague River Water Quality Lab
Lab ID: 24120238-02
Client Sample ID: 4120403-02
Project: RES-Yurok
Sample Location: Comp

Collection Date: 12/3/2024 10:09:00 AM
Received Date: 12/5/2024 10:20:00 AM
Matrix: AQUEOUS

Analyses	Method	NELAP Status	Result Qual	DF	MDL	RL	Units	MCL	Date Analyzed	Analyst
DISSOLVED TRACE METALS										
Aluminum, Dissolved	E200.7	A	0.0180 J	1	0.00895	0.0200	mg/L		12/10/24 14:10	CBB
TRACE METALS BY EPA 200.7 ICP										
Aluminum	E200.7	A	0.189	1	0.00895	0.0200	mg/L		12/10/24 15:59	CBB
DISSOLVED ORGANIC CARBON BY SM 5310 C-2014										
Organic Carbon, Dissolved	A5310C	A	1.60	1	0.192	0.500	mg/L		12/05/24 18:34	KN
TOTAL ORGANIC CARBON SM 5310 C-2014										
Organic Carbon, Total	A5310C	A	1.59	1	0.142	0.500	mg/L		12/06/24 0:38	KN

QUALIFIERS

C1	Sample container temperature is out of limit as specified at testcode	E	Value above quantitation range
H	Holding times for preparation or analysis exceeded	J	Analyte detected below quantitation limits
MI	Recovery outside control limits due to Matrix Interference	ND	Not Detected at the Reporting Limit
PL	Permit Limit		

Original

NELAP

NELAP A Accredited in accordance with NELAP ORELAP 100016, OR-028



Neilson Research Corporation
 245 S Grape St
 Medford, OR 97501
 TEL: (541) 770-5678 FAX: (541) 770-2901
 Website: www.nrclabs.com

Analytical Report

WO#: 24120238
 Date Reported: 12/18/2024

CLIENT: Sprague River Water Quality Lab
Lab ID: 24120238-03
Client Sample ID: 4120403-03
Project: RES-Yurok
Sample Location: Comp

Collection Date: 12/3/2024 11:14:00 AM
Received Date: 12/5/2024 10:20:00 AM
Matrix: AQUEOUS

Analyses	Method	NELAP Status	Result Qual	DF	MDL	RL	Units	MCL	Date Analyzed	Analyst
DISSOLVED TRACE METALS										
Aluminum, Dissolved	E200.7	A	0.0193 J	1	0.00895	0.0200	mg/L		12/10/24 14:14	CBB
TRACE METALS BY EPA 200.7 ICP										
Aluminum	E200.7	A	0.261	1	0.00895	0.0200	mg/L		12/10/24 16:02	CBB
DISSOLVED ORGANIC CARBON BY SM 5310 C-2014										
Organic Carbon, Dissolved	A5310C	A	1.59	1	0.192	0.500	mg/L		12/05/24 18:53	KN
TOTAL ORGANIC CARBON SM 5310 C-2014										
Organic Carbon, Total	A5310C	A	3.24	1	0.142	0.500	mg/L		12/06/24 1:15	KN

QUALIFIERS

C1	Sample container temperature is out of limit as specified at testcode	E	Value above quantitation range
H	Holding times for preparation or analysis exceeded	J	Analyte detected below quantitation limits
MI	Recovery outside control limits due to Matrix Interference	ND	Not Detected at the Reporting Limit
PL	Permit Limit		

Original

NELAP

NELAP A Accredited in accordance with NELAP ORELAP 100016, OR-028



Neilson Research Corporation
 245 S Grape St
 Medford, OR 97501
 TEL: (541) 770-5678 FAX: (541) 770-2901
 Website: www.nrclabs.com

Analytical Report

WO#: 24120238
 Date Reported: 12/18/2024

CLIENT: Sprague River Water Quality Lab
Lab ID: 24120238-04
Client Sample ID: 4120403-04
Project: RES-Yurok
Sample Location: Comp

Collection Date: 12/3/2024 10:39:00 AM
Received Date: 12/5/2024 10:20:00 AM
Matrix: AQUEOUS

Analyses	Method	NELAP Status	Result Qual	DF	MDL	RL	Units	MCL	Date Analyzed	Analyst
DISSOLVED ORGANIC CARBON BY SM 5310 C-2014										
Organic Carbon, Dissolved	A5310C	A	0.295 J	1	0.192	0.500	mg/L		12/05/24 19:11	KN
TOTAL ORGANIC CARBON SM 5310 C-2014										
Organic Carbon, Total	A5310C	A	0.297 J	1	0.142	0.500	mg/L		12/06/24 1:33	KN

QUALIFIERS

C1	Sample container temperature is out of limit as specified at testcode	E	Value above quantitation range
H	Holding times for preparation or analysis exceeded	J	Analyte detected below quantitation limits
MI	Recovery outside control limits due to Matrix Interference	ND	Not Detected at the Reporting Limit
PL	Permit Limit		

Original

NELAP

NELAP A Accredited in accordance with NELAP ORELAP 100016, OR-028



Neilson Research Corporation
 245 S Grape St
 Medford, OR 97501
 TEL: (541) 770-5678 FAX: (541) 770-2901
 Website: www.nrclabs.com

Analytical Report

WO#: 24120238
 Date Reported: 12/18/2024

CLIENT: Sprague River Water Quality Lab
Lab ID: 24120238-05
Client Sample ID: 4120403-05
Project: RES-Yurok
Sample Location: Comp

Collection Date: 12/3/2024 8:38:00 AM
Received Date: 12/5/2024 10:20:00 AM
Matrix: AQUEOUS

Analyses	Method	NELAP Status	Result Qual	DF	MDL	RL	Units	MCL	Date Analyzed	Analyst
DISSOLVED TRACE METALS										
Aluminum, Dissolved	E200.7	A	ND	1	0.00895	0.0200	mg/L		12/10/24 14:17	CBB
TRACE METALS BY EPA 200.7 ICP										
Aluminum	E200.7	A	ND	1	0.00895	0.0200	mg/L		12/10/24 16:05	CBB
DISSOLVED ORGANIC CARBON BY SM 5310 C-2014										
Organic Carbon, Dissolved	A5310C	A	0.212 J	1	0.192	0.500	mg/L		12/05/24 19:29	KN
TOTAL ORGANIC CARBON SM 5310 C-2014										
Organic Carbon, Total	A5310C	A	0.192 J	1	0.142	0.500	mg/L		12/06/24 1:51	KN

QUALIFIERS

- C1 Sample container temperature is out of limit as specified at testcode
- H Holding times for preparation or analysis exceeded
- MI Recovery outside control limits due to Matrix Interference
- PL Permit Limit
- E Value above quantitation range
- J Analyte detected below quantitation limits
- ND Not Detected at the Reporting Limit

Original

NELAP

NELAP A Accredited in accordance with NELAP ORELAP 100016, OR-028



Neilson Research Corporation
 245 S Grape St
 Medford, OR 97501
 TEL: (541) 770-5678 FAX: (541) 770-2901
 Website: www.nrclabs.com

Analytical Report

WO#: 24120238
 Date Reported: 12/18/2024

CLIENT: Sprague River Water Quality Lab
Lab ID: 24120238-06
Client Sample ID 4120404-01
Project: RES-Yurok
Sample Location: Comp

Collection Date: 12/3/2024 7:56:00 AM
Received Date: 12/5/2024 10:20:00 AM
Matrix: AQUEOUS

Analyses	Method	NELAP Status	Result Qual	DF	MDL	RL	Units	MCL	Date Analyzed	Analyst
DISSOLVED TRACE METALS										
Aluminum, Dissolved	E200.7	A	0.0163 J	1	0.00895	0.0200	mg/L		12/10/24 14:20	CBB
TRACE METALS BY EPA 200.7 ICP										
Aluminum	E200.7	A	0.293	1	0.00895	0.0200	mg/L		12/10/24 16:08	CBB
DISSOLVED ORGANIC CARBON BY SM 5310 C-2014										
Organic Carbon, Dissolved	A5310C	A	1.96	1	0.192	0.500	mg/L		12/05/24 19:47	KN
TOTAL ORGANIC CARBON SM 5310 C-2014										
Organic Carbon, Total	A5310C	A	1.92	1	0.142	0.500	mg/L		12/06/24 2:09	KN

QUALIFIERS

C1	Sample container temperature is out of limit as specified at testcode	E	Value above quantitation range
H	Holding times for preparation or analysis exceeded	J	Analyte detected below quantitation limits
MI	Recovery outside control limits due to Matrix Interference	ND	Not Detected at the Reporting Limit
PL	Permit Limit		

Original

NELAP

NELAP A Accredited in accordance with NELAP ORELAP 100016, OR-028



Neilson Research Corporation
 245 S Grape St
 Medford, OR 97501
 TEL: (541) 770-5678 FAX: (541) 770-2901
 Website: www.nrclabs.com

Analytical Report

WO#: 24120238
 Date Reported: 12/18/2024

CLIENT: Sprague River Water Quality Lab
Lab ID: 24120238-07
Client Sample ID: 4120404-02
Project: RES-Yurok
Sample Location: Comp

Collection Date: 12/3/2024 9:46:00 AM
Received Date: 12/5/2024 10:20:00 AM
Matrix: AQUEOUS

Analyses	Method	NELAP Status	Result Qual	DF	MDL	RL	Units	MCL	Date Analyzed	Analyst
DISSOLVED TRACE METALS										
Aluminum, Dissolved	E200.7	A	0.0230	1	0.00895	0.0200	mg/L		12/10/24 14:23	CBB
TRACE METALS BY EPA 200.7 ICP										
Aluminum	E200.7	A	0.720	1	0.00895	0.0200	mg/L		12/10/24 16:11	CBB
DISSOLVED ORGANIC CARBON BY SM 5310 C-2014										
Organic Carbon, Dissolved	A5310C	A	3.43	1	0.192	0.500	mg/L		12/05/24 20:05	KN
TOTAL ORGANIC CARBON SM 5310 C-2014										
Organic Carbon, Total	A5310C	A	3.25	1	0.142	0.500	mg/L		12/06/24 3:04	KN

QUALIFIERS

- C1 Sample container temperature is out of limit as specified at testcode
- H Holding times for preparation or analysis exceeded
- MI Recovery outside control limits due to Matrix Interference
- PL Permit Limit
- E Value above quantitation range
- J Analyte detected below quantitation limits
- ND Not Detected at the Reporting Limit

Original

NELAP

NELAP A Accredited in accordance with NELAP ORELAP 100016, OR-028



Neilson Research Corporation
 245 S Grape St
 Medford, OR 97501
 TEL: (541) 770-5678 FAX: (541) 770-2901
 Website: www.nrclabs.com

Analytical Report

WO#: 24120238
 Date Reported: 12/18/2024

CLIENT: Sprague River Water Quality Lab
Lab ID: 24120238-08
Client Sample ID: 4120404-03
Project: RES-Yurok
Sample Location: Comp

Collection Date: 12/3/2024 11:28:00 AM
Received Date: 12/5/2024 10:20:00 AM
Matrix: AQUEOUS

Analyses	Method	NELAP Status	Result Qual	DF	MDL	RL	Units	MCL	Date Analyzed	Analyst
DISSOLVED TRACE METALS										
Aluminum, Dissolved	E200.7	A	0.0234	1	0.00895	0.0200	mg/L		12/10/24 14:26	CBB
TRACE METALS BY EPA 200.7 ICP										
Aluminum	E200.7	A	0.763	1	0.00895	0.0200	mg/L		12/10/24 16:23	CBB
DISSOLVED ORGANIC CARBON BY SM 5310 C-2014										
Organic Carbon, Dissolved	A5310C	A	4.59	1	0.192	0.500	mg/L		12/05/24 20:23	KN
TOTAL ORGANIC CARBON SM 5310 C-2014										
Organic Carbon, Total	A5310C	A	3.98	1	0.142	0.500	mg/L		12/06/24 3:22	KN

QUALIFIERS

- C1 Sample container temperature is out of limit as specified at testcode
- H Holding times for preparation or analysis exceeded
- MI Recovery outside control limits due to Matrix Interference
- PL Permit Limit
- E Value above quantitation range
- J Analyte detected below quantitation limits
- ND Not Detected at the Reporting Limit

Original

NELAP

NELAP A Accredited in accordance with NELAP ORELAP 100016, OR-028



Neilson Research Corporation
 245 S Grape St
 Medford, OR 97501
 TEL: (541) 770-5678 FAX: (541) 770-2901
 Website: www.nrclabs.com

Analytical Report

WO#: 24120238
 Date Reported: 12/18/2024

CLIENT: Sprague River Water Quality Lab
Lab ID: 24120238-09
Client Sample ID 4120404-04
Project: RES-Yurok
Sample Location: Comp

Collection Date: 12/3/2024 12:16:00 PM
Received Date: 12/5/2024 10:20:00 AM
Matrix: AQUEOUS

Analyses	Method	NELAP Status	Result Qual	DF	MDL	RL	Units	MCL	Date Analyzed	Analyst
DISSOLVED ORGANIC CARBON BY SM 5310 C-2014										
Organic Carbon, Dissolved	A5310C	A	4.48	1	0.192	0.500	mg/L		12/05/24 20:42	KN
TOTAL ORGANIC CARBON SM 5310 C-2014										
Organic Carbon, Total	A5310C	A	4.33	1	0.142	0.500	mg/L		12/06/24 3:40	KN

QUALIFIERS

- C1 Sample container temperature is out of limit as specified at testcode
- H Holding times for preparation or analysis exceeded
- MI Recovery outside control limits due to Matrix Interference
- PL Permit Limit
- E Value above quantitation range
- J Analyte detected below quantitation limits
- ND Not Detected at the Reporting Limit

Original

NELAP

NELAP A Accredited in accordance with NELAP ORELAP 100016, OR-028



Neilson Research Corporation
 245 S Grape St
 Medford, OR 97501
 TEL: (541) 770-5678 FAX: (541) 770-2901
 Website: www.nrclabs.com

Analytical Report

WO#: 24120238
 Date Reported: 12/18/2024

CLIENT: Sprague River Water Quality Lab
Lab ID: 24120238-10
Client Sample ID: 4120404-05
Project: RES-Yurok
Sample Location: Comp

Collection Date: 12/3/2024 1:10:00 PM
Received Date: 12/5/2024 10:20:00 AM
Matrix: AQUEOUS

Analyses	Method	NELAP Status	Result Qual	DF	MDL	RL	Units	MCL	Date Analyzed	Analyst
DISSOLVED ORGANIC CARBON BY SM 5310 C-2014										
Organic Carbon, Dissolved	A5310C	A	4.79	1	0.192	0.500	mg/L		12/05/24 21:00	KN
TOTAL ORGANIC CARBON SM 5310 C-2014										
Organic Carbon, Total	A5310C	A	4.66	1	0.142	0.500	mg/L		12/06/24 3:58	KN

QUALIFIERS

- C1 Sample container temperature is out of limit as specified at testcode
- H Holding times for preparation or analysis exceeded
- MI Recovery outside control limits due to Matrix Interference
- PL Permit Limit
- E Value above quantitation range
- J Analyte detected below quantitation limits
- ND Not Detected at the Reporting Limit

Original

NELAP

NELAP A Accredited in accordance with NELAP ORELAP 100016, OR-028



Neilson Research Corporation
 245 S Grape St
 Medford, OR 97501
 TEL: (541) 770-5678 FAX: (541) 770-2901
 Website: www.nrclabs.com

Analytical Report

WO#: 24120238
 Date Reported: 12/18/2024

CLIENT: Sprague River Water Quality Lab
Lab ID: 24120238-11
Client Sample ID: 4120404-06
Project: RES-Yurok
Sample Location: Comp

Collection Date: 12/3/2024 7:40:00 AM
Received Date: 12/5/2024 10:20:00 AM
Matrix: AQUEOUS

Analyses	Method	NELAP Status	Result Qual	DF	MDL	RL	Units	MCL	Date Analyzed	Analyst
DISSOLVED TRACE METALS										
Aluminum, Dissolved	E200.7	A	ND	1	0.00895	0.0200	mg/L		12/10/24 14:30	CBB
TRACE METALS BY EPA 200.7 ICP										
Aluminum	E200.7	A	ND	1	0.00895	0.0200	mg/L		12/17/24 13:55	CJS
DISSOLVED ORGANIC CARBON BY SM 5310 C-2014										
Organic Carbon, Dissolved	A5310C	A	0.441 J	1	0.192	0.500	mg/L		12/05/24 22:31	KN
TOTAL ORGANIC CARBON SM 5310 C-2014										
Organic Carbon, Total	A5310C	A	0.370 J	1	0.142	0.500	mg/L		12/06/24 4:16	KN


QUALIFIERS

C1	Sample container temperature is out of limit as specified at testcode	E	Value above quantitation range
H	Holding times for preparation or analysis exceeded	J	Analyte detected below quantitation limits
MI	Recovery outside control limits due to Matrix Interference	ND	Not Detected at the Reporting Limit
PL	Permit Limit		

Original

NELAP

NELAP A Accredited in accordance with NELAP ORELAP 100016, OR-028

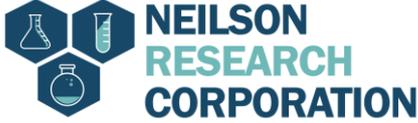

Neilson Research Corporation
 245 S Grape St
 Medford, OR 97501
 TEL: (541) 770-5678 FAX: (541) 770-2901
 Website: www.nrclabs.com

Analytical Report

WO#: 24120238
 Date Reported: 12/18/2024

CLIENT: Sprague River Water Quality Lab
Lab ID: 24120238-12
Client Sample ID: 4120404-07
Project: RES-Yurok
Sample Location: Comp

Collection Date: 12/4/2024 8:05:00 AM
Received Date: 12/5/2024 10:20:00 AM
Matrix: AQUEOUS

Analyses	Method	NELAP Status	Result Qual	DF	MDL	RL	Units	MCL	Date Analyzed	Analyst
DISSOLVED ORGANIC CARBON BY SM 5310 C-2014										
Organic Carbon, Dissolved	A5310C	A	4.83	1	0.192	0.500	mg/L		12/05/24 23:07	KN
TOTAL ORGANIC CARBON SM 5310 C-2014										
Organic Carbon, Total	A5310C	A	4.37	1	0.142	0.500	mg/L		12/06/24 4:34	KN


QUALIFIERS

- C1 Sample container temperature is out of limit as specified at testcode
- H Holding times for preparation or analysis exceeded
- MI Recovery outside control limits due to Matrix Interference
- PL Permit Limit
- E Value above quantitation range
- J Analyte detected below quantitation limits
- ND Not Detected at the Reporting Limit

Original

NELAP

NELAP A Accredited in accordance with NELAP ORELAP 100016, OR-028

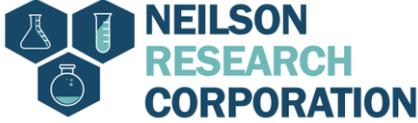

Neilson Research Corporation
 245 S Grape St
 Medford, OR 97501
 TEL: (541) 770-5678 FAX: (541) 770-2901
 Website: www.nrclabs.com

Analytical Report

WO#: 24120238
 Date Reported: 12/18/2024

CLIENT: Sprague River Water Quality Lab
Lab ID: 24120238-13
Client Sample ID: 4120404-08
Project: RES-Yurok
Sample Location: Comp

Collection Date: 12/4/2024 8:55:00 AM
Received Date: 12/5/2024 10:20:00 AM
Matrix: AQUEOUS

Analyses	Method	NELAP Status	Result Qual	DF	MDL	RL	Units	MCL	Date Analyzed	Analyst
DISSOLVED ORGANIC CARBON BY SM 5310 C-2014										
Organic Carbon, Dissolved	A5310C	A	5.44	1	0.192	0.500	mg/L		12/05/24 23:43	KN
TOTAL ORGANIC CARBON SM 5310 C-2014										
Organic Carbon, Total	A5310C	A	5.56	1	0.142	0.500	mg/L		12/06/24 4:53	KN

QUALIFIERS

- C1 Sample container temperature is out of limit as specified at testcode
- H Holding times for preparation or analysis exceeded
- MI Recovery outside control limits due to Matrix Interference
- PL Permit Limit
- E Value above quantitation range
- J Analyte detected below quantitation limits
- ND Not Detected at the Reporting Limit

Original

NELAP

NELAP A Accredited in accordance with NELAP ORELAP 100016, OR-028



Neilson Research Corporation
 245 S Grape St
 Medford, OR 97501
 TEL: (541) 770-5678 FAX: (541) 770-2901
 Website: www.nrclabs.com

QC SUMMARY REPORT

WO#: 24120238
 19-Dec-24

Client: Sprague River Water Quality Lab
Project: RES-Yurok

TestCode: DOC_W

Sample ID: MB	SampType: MBLK	TestCode: DOC_W	Units: mg/L	Prep Date: 12/5/2024	RunNo: 54687
Client ID: PBW	Batch ID: R54687	TestNo: A5310C		Analysis Date: 12/5/2024	SeqNo: 903826
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC LowLimit HighLimit RPD Ref Val %RPD RPDLimit Qual

Organic Carbon, Dissolved

ND 0.500

Sample ID: MB-29512	SampType: MBLK	TestCode: DOC_W	Units: mg/L	Prep Date: 12/4/2024	RunNo: 54687
Client ID: PBW	Batch ID: R54687	TestNo: A5310C		Analysis Date: 12/5/2024	SeqNo: 903826
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC LowLimit HighLimit RPD Ref Val %RPD RPDLimit Qual

Organic Carbon, Dissolved

ND 0.500

Sample ID: LCS - 15599	SampType: LCS	TestCode: DOC_W	Units: mg/L	Prep Date: 12/5/2024	RunNo: 54687
Client ID: LCSW	Batch ID: R54687	TestNo: A5310C		Analysis Date: 12/5/2024	SeqNo: 903828
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC LowLimit HighLimit RPD Ref Val %RPD RPDLimit Qual

Organic Carbon, Dissolved

3.92 0.500 3.750 0 105 90 110

Sample ID: LCS-29512	SampType: LCS	TestCode: DOC_W	Units: mg/L	Prep Date: 12/4/2024	RunNo: 54687
Client ID: LCSW	Batch ID: R54687	TestNo: A5310C		Analysis Date: 12/5/2024	SeqNo: 903829
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC LowLimit HighLimit RPD Ref Val %RPD RPDLimit Qual

Organic Carbon, Dissolved

3.86 0.500 3.750 0 103 90 110

Qualifiers: C1 Sample container temperature is out of limit as specified at testcode E Value above quantitation range H Holding times for preparation or analysis exceeds
 J Analyte detected below quantitation limits MI Recovery outside control limits due to Matrix Interference ND Not Detected at the Reporting Limit
 PL Permit Limit RL Reporting Detection Limit

Original



Neilson Research Corporation
 245 S Grape St
 Medford, OR 97501
 TEL: (541) 770-5678 FAX: (541) 770-2901
 Website: www.nrclabs.com

QC SUMMARY REPORT

WO#: 24120238
 19-Dec-24

Client: Sprague River Water Quality Lab
Project: RES-Yurok

TestCode: DOC_W

Sample ID: 24120152-02CMS	SampType: MS	TestCode: DOC_W	Units: mg/L	Prep Date: 12/4/2024	RunNo: 54687						
Client ID: BatchQC	Batch ID: R54687	TestNo: A5310C		Analysis Date: 12/5/2024	SeqNo: 903832						
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD	RPDLimit	Qual
Organic Carbon, Dissolved	16.8	1.00	5.000	11.28	110	85	115				E

Sample ID: 24120152-04CDUP	SampType: DUP	TestCode: DOC_W	Units: mg/L	Prep Date: 12/4/2024	RunNo: 54687						
Client ID: BatchQC	Batch ID: R54687	TestNo: A5310C		Analysis Date: 12/5/2024	SeqNo: 903834						
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD	RPDLimit	Qual
Organic Carbon, Dissolved	1.61	0.500						1.687	4.96	15	

Sample ID: MB-29527	SampType: MBLK	TestCode: DOC_W	Units: mg/L	Prep Date: 12/5/2024	RunNo: 54687						
Client ID: PBW	Batch ID: R54687	TestNo: A5310C		Analysis Date: 12/5/2024	SeqNo: 903835						
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD	RPDLimit	Qual
Organic Carbon, Dissolved	ND	0.500									

Sample ID: LCS-29527	SampType: LCS	TestCode: DOC_W	Units: mg/L	Prep Date: 12/5/2024	RunNo: 54687						
Client ID: LCSW	Batch ID: R54687	TestNo: A5310C		Analysis Date: 12/5/2024	SeqNo: 903836						
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD	RPDLimit	Qual
Organic Carbon, Dissolved	3.81	0.500	3.750	0	102	90	110				

Qualifiers:	C1	Sample container temperature is out of limit as specified at testcode	E	Value above quantitation range	H	Holding times for preparation or analysis exceeds
	J	Analyte detected below quantitation limits	MI	Recovery outside control limits due to Matrix Interference	ND	Not Detected at the Reporting Limit
	PL	Permit Limit	RL	Reporting Detection Limit		

Original



Neilson Research Corporation
 245 S Grape St
 Medford, OR 97501
 TEL: (541) 770-5678 FAX: (541) 770-2901
 Website: www.nrclabs.com

QC SUMMARY REPORT

WO#: 24120238
 19-Dec-24

Client: Sprague River Water Quality Lab
Project: RES-Yurok

TestCode: DOC_W

Sample ID: MBLK	SampType: MBLK	TestCode: DOC_W	Units: mg/L	Prep Date: 12/5/2024	RunNo: 54689
Client ID: PBW	Batch ID: R54689	TestNo: A5310C		Analysis Date: 12/5/2024	SeqNo: 903878
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC LowLimit HighLimit RPD Ref Val %RPD RPDLimit Qual
Organic Carbon, Dissolved	ND	0.500			

Sample ID: LCS-15599	SampType: LCS	TestCode: DOC_W	Units: mg/L	Prep Date: 12/5/2024	RunNo: 54689
Client ID: LCSW	Batch ID: R54689	TestNo: A5310C		Analysis Date: 12/5/2024	SeqNo: 903879
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC LowLimit HighLimit RPD Ref Val %RPD RPDLimit Qual
Organic Carbon, Dissolved	3.93	0.500	3.750	0	105 90 110

Sample ID: 24120238-11BMS	SampType: MS	TestCode: DOC_W	Units: mg/L	Prep Date: 12/5/2024	RunNo: 54689
Client ID: 4120404-06	Batch ID: R54689	TestNo: A5310C		Analysis Date: 12/5/2024	SeqNo: 903881
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC LowLimit HighLimit RPD Ref Val %RPD RPDLimit Qual
Organic Carbon, Dissolved	3.00	0.500	2.500	0.4413	102 85 115

Sample ID: 24120238-12BDUP	SampType: DUP	TestCode: DOC_W	Units: mg/L	Prep Date: 12/5/2024	RunNo: 54689
Client ID: 4120404-07	Batch ID: R54689	TestNo: A5310C		Analysis Date: 12/5/2024	SeqNo: 903883
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC LowLimit HighLimit RPD Ref Val %RPD RPDLimit Qual
Organic Carbon, Dissolved	4.55	0.500			4.829 5.89 15

Qualifiers: C1 Sample container temperature is out of limit as specified at testcode E Value above quantitation range H Holding times for preparation or analysis exceeds
 J Analyte detected below quantitation limits MI Recovery outside control limits due to Matrix Interference ND Not Detected at the Reporting Limit
 PL Permit Limit RL Reporting Detection Limit

Original



Neilson Research Corporation
 245 S Grape St
 Medford, OR 97501
 TEL: (541) 770-5678 FAX: (541) 770-2901
 Website: www.nrclabs.com

QC SUMMARY REPORT

WO#: 24120238
 19-Dec-24

Client: Sprague River Water Quality Lab
Project: RES-Yurok

TestCode: ICP_200.7_W

Sample ID: MB-29534	SampType: MBLK	TestCode: ICP_200.7_W	Units: mg/L	Prep Date: 12/6/2024	RunNo: 54778
Client ID: PBW	Batch ID: 29534	TestNo: E200.7	E200.7	Analysis Date: 12/10/2024	SeqNo: 905316
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC LowLimit HighLimit RPD Ref Val %RPD RPDLimit Qual

Aluminum ND 0.0200

Sample ID: LCS-29534	SampType: LCS	TestCode: ICP_200.7_W	Units: mg/L	Prep Date: 12/6/2024	RunNo: 54778
Client ID: LCSW	Batch ID: 29534	TestNo: E200.7	E200.7	Analysis Date: 12/10/2024	SeqNo: 905317
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC LowLimit HighLimit RPD Ref Val %RPD RPDLimit Qual

Aluminum 1.06 0.0200 1.000 0 106 85 115

Sample ID: 24111142-01AMS	SampType: MS	TestCode: ICP_200.7_W	Units: mg/L	Prep Date: 12/6/2024	RunNo: 54778
Client ID: BatchQC	Batch ID: 29534	TestNo: E200.7	E200.7	Analysis Date: 12/10/2024	SeqNo: 905319
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC LowLimit HighLimit RPD Ref Val %RPD RPDLimit Qual

Aluminum 49.5 0.0200 11.00 37.08 113 70 130

Sample ID: 24111142-01AMSD	SampType: MSD	TestCode: ICP_200.7_W	Units: mg/L	Prep Date: 12/6/2024	RunNo: 54778
Client ID: BatchQC	Batch ID: 29534	TestNo: E200.7	E200.7	Analysis Date: 12/10/2024	SeqNo: 905320
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC LowLimit HighLimit RPD Ref Val %RPD RPDLimit Qual

Aluminum 47.9 0.0200 11.00 37.08 98.1 70 130 49.55 3.44 20

Qualifiers: C1 Sample container temperature is out of limit as specified at testcode E Value above quantitation range H Holding times for preparation or analysis exceeds
 J Analyte detected below quantitation limits MI Recovery outside control limits due to Matrix Interference ND Not Detected at the Reporting Limit
 PL Permit Limit RL Reporting Detection Limit

Original



Neilson Research Corporation
 245 S Grape St
 Medford, OR 97501
 TEL: (541) 770-5678 FAX: (541) 770-2901
 Website: www.nrclabs.com

QC SUMMARY REPORT

WO#: 24120238
 19-Dec-24

Client: Sprague River Water Quality Lab
Project: RES-Yurok

TestCode: ICP_200.7_W

Sample ID: MB-29610	SampType: MBLK	TestCode: ICP_200.7_W	Units: mg/L	Prep Date: 12/13/2024	RunNo: 54936
Client ID: PBW	Batch ID: 29610	TestNo: E200.7	E200.7	Analysis Date: 12/17/2024	SeqNo: 908235
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC LowLimit HighLimit RPD Ref Val %RPD RPDLimit Qual

Aluminum ND 0.0200

Sample ID: LCS-29610	SampType: LCS	TestCode: ICP_200.7_W	Units: mg/L	Prep Date: 12/13/2024	RunNo: 54936
Client ID: LCSW	Batch ID: 29610	TestNo: E200.7	E200.7	Analysis Date: 12/17/2024	SeqNo: 908236
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC LowLimit HighLimit RPD Ref Val %RPD RPDLimit Qual

Aluminum 0.957 0.0200 1.000 0 95.7 85 115

Sample ID: 24120238-11CMS	SampType: MS	TestCode: ICP_200.7_W	Units: mg/L	Prep Date: 12/13/2024	RunNo: 54936
Client ID: 4120404-06	Batch ID: 29610	TestNo: E200.7	E200.7	Analysis Date: 12/17/2024	SeqNo: 908238
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC LowLimit HighLimit RPD Ref Val %RPD RPDLimit Qual

Aluminum 9.92 0.0200 11.00 0 90.2 70 130

Sample ID: 24120238-11CMSD	SampType: MSD	TestCode: ICP_200.7_W	Units: mg/L	Prep Date: 12/13/2024	RunNo: 54936
Client ID: 4120404-06	Batch ID: 29610	TestNo: E200.7	E200.7	Analysis Date: 12/17/2024	SeqNo: 908239
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC LowLimit HighLimit RPD Ref Val %RPD RPDLimit Qual

Aluminum 10.0 0.0200 11.00 0 91.3 70 130 9.920 1.20 20

Qualifiers: C1 Sample container temperature is out of limit as specified at testcode E Value above quantitation range H Holding times for preparation or analysis exceed
 J Analyte detected below quantitation limits MI Recovery outside control limits due to Matrix Interference ND Not Detected at the Reporting Limit
 PL Permit Limit RL Reporting Detection Limit

Original



Neilson Research Corporation
 245 S Grape St
 Medford, OR 97501
 TEL: (541) 770-5678 FAX: (541) 770-2901
 Website: www.nrclabs.com

QC SUMMARY REPORT

WO#: 24120238
 19-Dec-24

Client: Sprague River Water Quality Lab
Project: RES-Yurok

TestCode: ICP_200.7_W_DISS2

Sample ID: 24111235-01AMSD	SampType: MSD	TestCode: ICP_200.7_W	Units: mg/L	Prep Date: 12/6/2024	RunNo: 54777						
Client ID: BatchQC	Batch ID: 29535	TestNo: E200.7	E3005	Analysis Date: 12/10/2024	SeqNo: 905274						
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD	RPDLimit	Qual
Aluminum, Dissolved	11.4	0.0200	11.00	0.03580	103	70	130	10.87	4.86	20	

Sample ID: MB-29535	SampType: MBLK	TestCode: ICP_200.7_W	Units: mg/L	Prep Date: 12/6/2024	RunNo: 54777						
Client ID: PBW	Batch ID: 29535	TestNo: E200.7	E3005	Analysis Date: 12/10/2024	SeqNo: 905305						
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD	RPDLimit	Qual
Aluminum, Dissolved	ND	0.0200									

Sample ID: LCS-29535	SampType: LCS	TestCode: ICP_200.7_W	Units: mg/L	Prep Date: 12/6/2024	RunNo: 54777						
Client ID: LCSW	Batch ID: 29535	TestNo: E200.7	E3005	Analysis Date: 12/10/2024	SeqNo: 905306						
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD	RPDLimit	Qual
Aluminum, Dissolved	1.07	0.0200	1.000	0	107	85	115				

Sample ID: 24111235-01AMS	SampType: MS	TestCode: ICP_200.7_W	Units: mg/L	Prep Date: 12/6/2024	RunNo: 54777						
Client ID: BatchQC	Batch ID: 29535	TestNo: E200.7	E3005	Analysis Date: 12/10/2024	SeqNo: 905308						
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD	RPDLimit	Qual
Aluminum, Dissolved	10.9	0.0200	11.00	0.03580	98.5	70	130				

Qualifiers:	C1	Sample container temperature is out of limit as specified at testcode	E	Value above quantitation range	H	Holding times for preparation or analysis exceeds
	J	Analyte detected below quantitation limits	MI	Recovery outside control limits due to Matrix Interference	ND	Not Detected at the Reporting Limit
	PL	Permit Limit	RL	Reporting Detection Limit		

Original



Sample Log-In Check List

Client Name: **SPRAGUERIVERWATER** Work Order Number: **24120238** RcptNo: **1**

Logged by:	Ashley Spiegelberg	12/5/2024 10:20:00 AM	
Completed By:	Danielle Garten	12/9/2024 3:40:50 PM	
Reviewed By:	Jordan Diemer	12/18/2024 2:17:11 PM	

Chain of Custody

- 1. Is Chain of Custody complete? Yes No Not Present
- 2. How was the sample delivered? UPS

Log In

- 3. Coolers are present? Yes No NA
- 4. Shipping container/cooler in good condition? Yes No
- Custody seals intact on shipping container/cooler? Yes No Not Present NA
- No. Seal Date: Signed By:
- 5. Was an attempt made to cool the samples? Yes No NA
- 6. Were all samples received at a temperature of >0° C to 6.0°C Yes No NA
- 7. Sample(s) in proper container(s)? Yes No
- 8. Sufficient sample volume for indicated test(s)? Yes No
- 9. Are samples (except VOA and ONG) properly preserved? Yes No
- 10. Was preservative added to bottles? Yes No NA
- 11. Is the headspace in the VOA vials less than 1/4 inch or 6 mm? Yes No HNO3 pH<2
No VOA Vials
- 12. Were any sample containers received broken? Yes No
- 13. Does paperwork match bottle labels? Yes No
(Note discrepancies on chain of custody)
- 14. Are matrices correctly identified on Chain of Custody? Yes No
- 15. Is it clear what analyses were requested? Yes No
- 16. Were all holding times able to be met? Yes No
(If no, notify customer for authorization.)

Special Handling (if applicable)

- 17. Was client notified of all discrepancies with this order? Yes No NA

Person Notified:	<input type="text"/>	Date:	<input type="text"/>
By Whom:	<input type="text"/>	Via:	<input type="checkbox"/> eMail <input type="checkbox"/> Phone <input type="checkbox"/> Fax <input type="checkbox"/> In Person
Regarding:	<input type="text"/>		
Client Instructions:	<input type="text"/>		

- 18. Additional remarks:

Cooler Information

Cooler No	Temp °C	Condition	Seal Intact	Seal No	Seal Date	Signed By
1	4.3	Good				AS



Chain of Custody Record

This Chain of Custody is a LEGAL DOCUMENT and must be filled out accurately.

Section A Required Client Information		Section B Required Project Information		Section C Invoice Information		Section D Rush Status (Subject to Scheduling)	
Company: Sprague River Water Quality Lab		Project Name: RES-Yurok		Attention: Kaneeta Kirk		<input checked="" type="checkbox"/> Standard: 10 Business Days	
Address: 5671 Sprague River Road		Project Number:		Company Name: The Klamath Tribes		<input type="checkbox"/> Priority: 5 Business Days (List x 1.50)	
Chiloquin, OR 97624		Report To:		Address: PO Box 436		<input type="checkbox"/> Express: 3 Business Days (List x 1.75)	
Email: teresa.coley@klamathtribes.com		Copy To:		Chiloquin, OR 97624		<input type="checkbox"/> Rush: 2 Business Days (List x 2.00)	
Phone: (541) 827-5231 Fax:				P.O. #		<input type="checkbox"/> Rush: 1 Business Day (List x 2.50)	
Collected By (Print):						<input type="checkbox"/> Rush: Same Day (List x 3.00)	
Collected By (Sign):						Authorized <input type="checkbox"/> Yes <input type="checkbox"/> No	
Email Report <input checked="" type="checkbox"/> Mail Report <input type="checkbox"/> Fax Report <input type="checkbox"/>							

Section E Sample Information					Analysis Requested										NRC Workorder # (Lab Use Only) <u>24120238</u>				
Sample ID	Comp/Grab	Matrix*	Date Collected	Time Collected	No. of Containers	TOC	DOC	Total Aluminum	Dissolved Aluminum								Remarks / Field Data	NRC Sample # (Lab Use Only)	(Lab)
4120403-01	Comp	Water	12/3/24	10:09	8	✓	✓	✓	✓									01	
4120403-02	Comp	Water	12/3/24	10:09	8	✓	✓	✓	✓									02	
4120403-03	Comp	Water	12/3/24	11:14	8	✓	✓	✓	✓									03	
4120403-04	Comp	Water	12/3/24	10:39	6	✓	✓	✓	✓									04	
4120403-05	Comp	Water	12/3/24	08:38	8	✓	✓	✓	✓									05	

*Matrix: DW - Drinking Water WW - Wastewater W - Water S - Soil/Solid SL - Sludge O - Oil WP - Wipe OT - Other

Section F Relinquish/Receive	Sign	Print	Date	Time
Relinquished By:				
Received By:				
Relinquished By:				
Received By:	<i>hee</i>	<i>next</i>		
Relinquished By:				
Received By Laboratory:	<i>[Signature]</i>	<i>Ashley Siegelberg</i>	<i>12/5/24</i>	<i>10:20</i>

Section G Lab Use Only	
Temp:	<i>4.3 IR-Q</i>
≤6°C:	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No
Received on Ice:	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No
Number of Bottles Received:	
pH Checked:	
COC Seals Intact:	<input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> NA
Field Blank Included:	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No
Received Via	<input checked="" type="checkbox"/> UPS <input type="checkbox"/> FedEx <input type="checkbox"/> Other <input type="checkbox"/> Hand
Payment:	<input checked="" type="checkbox"/> Invoice <input type="checkbox"/> Cash <input type="checkbox"/> VISA, M/C <input type="checkbox"/> Check # <input type="checkbox"/> Amount



Chain of Custody Record

This Chain of Custody is a LEGAL DOCUMENT and must be filled out accurately.

Section A Required Client Information		Section B Required Project Information		Section C Invoice Information		Section D Rush Status (Subject to Scheduling)	
Company: Sprague River Water Quality Lab		Project Name: RES-Karuk		Attention: Kaneeta Kirk		<input checked="" type="checkbox"/> Standard: 10 Business Days	
Address: 5671 Sprague River Road		Project Number:		Company Name: The Klamath Tribes		<input type="checkbox"/> Priority: 5 Business Days (List x 1.50)	
Chiloquin, OR 97624		Report To:		Address: PO Box 436		<input type="checkbox"/> Express: 3 Business Days (List x 1.75)	
Email: teresa.coley@klamathtribes.com		Copy To:		Chiloquin, OR 97624		<input type="checkbox"/> Rush: 2 Business Days (List x 2.00)	
Phone: (541) 827-5231 Fax:				P.O. #		<input type="checkbox"/> Rush: 1 Business Day (List x 2.50)	
Collected By (Print):						<input type="checkbox"/> Rush: Same Day (List x 3.00)	
Collected By (Sign):						Authorized <input type="checkbox"/> Yes <input type="checkbox"/> No	
Email Report <input checked="" type="checkbox"/> Mail Report <input type="checkbox"/> Fax Report <input type="checkbox"/>							

Section E Sample Information					Analysis Requested										NRC Workorder # (Lab Use Only) <u>24120238</u>		
Sample ID	Comp/Grab	Matrix*	Date Collected	Time Collected	No. of Containers	TOC	DOC	Total Aluminum	Dissolved Aluminum							Remarks / Field Data	NRC Sample # (Lab Use Only)
4120404-01	Comp	Water	12/3/24	07:56	8	✓	✓	✓	✓								06
4120404-02	Comp	Water	12/3/24	09:46	8	✓	✓	✓	✓								07
4120404-03	Comp	Water	12/3/24	11:28	8	✓	✓	✓	✓								08
4120404-04	Comp	Water	12/3/24	12:16	6	✓	✓										09
4120404-05	Comp	Water	12/3/24	13:10	6	✓	✓										10
4120404-06	Comp	Water	12/3/24	07:40	8	✓	✓	✓	✓								11
4120404-07	Comp	Water	12/4/24	08:05	6	✓	✓										12
4120404-08	Comp	Water	12/4/24	08:55	6	✓	✓										13

*Matrix: DW - Drinking Water WW - Wastewater W - Water S - Soil/Solid SL - Sludge O - Oil WP - Wipe OT - Other

Relinquish/Receive	Sign	Print	Date	Time
Relinquished By:				
Received By:				
Relinquished By:				
Received By:				
Relinquished By: <i>Ben A. Harris</i>	<i>Ben A. Harris</i>	<i>Ben A. Harris</i>	<i>12-4-24</i>	<i>1422</i>
Received By Laboratory: <i>Ashley Spiegelberg</i>	<i>Ashley Spiegelberg</i>	<i>Ashley Spiegelberg</i>	<i>12/5/24</i>	<i>10:20</i>

Section G Lab Use Only	
Temp:	<u>4.3 IR-Q</u>
≤6°C:	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No
Received on Ice:	<input type="checkbox"/> Yes <input type="checkbox"/> No
Number of Bottles Received:	
pH Checked:	<input checked="" type="checkbox"/>
COC Seals Intact:	<input type="checkbox"/> Yes <input type="checkbox"/> No <u>NA</u>
Field Blank Included:	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No
Received Via:	<input checked="" type="checkbox"/> UPS <input type="checkbox"/> FedEx <input type="checkbox"/> Other <input type="checkbox"/> Hand

Payment:	<input checked="" type="checkbox"/> Invoice <input type="checkbox"/> Cash <input type="checkbox"/> VISA, M/C <input type="checkbox"/> Check # <input type="checkbox"/> Amount
----------	---

Effective 6/19/2020

-
- A Total Alkalinity and Bicarbonate Alkalinity results are to a pH endpoint of 4.5. Carbonate Alkalinity result is to a pH endpoint of 8.3.
- A-LL The total low level alkalinity results are to a pH endpoint of 4.3-4.7 pH units per SM 2320 B.
- B Analyte detected in the associated method blank.
- C Sample(s) does not meet NELAP/ORELAP sample acceptance criteria. See Case Narrative.
- C1 Sample(s) does not meet NELAP/ORELAP sample acceptance criteria for temperature.
- CF Results confirmed by re-analysis.
- CU Cleanup performed as specified by method.
- E Estimated value.
- ER Elevated reporting limit due to matrix. Report limits (MDLs, MRLs & PQLs) are adjusted based on variations in sample preparation amounts, analytical dilutions, and percent solids, where applicable.
- FC Fecal Coliforms: Sample(s) received past 40 CFR Part 136 specified holding time. Results reported as estimated values.
- HP Sample re-analysis performed outside of method specified holding time.
- HR Sample received outside of method specified holding time.
- HS Sample analyzed for volatile organics contained headspace.
- HT At the client's request, the sample was analyzed outside of method specified holding time.
- H Analysis performed outside of method specified holding time.
- J Analyte detected below the Minimum Reporting Limit (MRL) and above the Method Detection Limit (MDL). The J flag result is an estimated value and the user should be aware that this data is of limited reliability.
- L Dissolved metals were not filtered within 15 minutes of collection per 40 CFR Part 136.
- MI Surrogate, Duplicate Sample (DUP) or Matrix Spikes recoveries are out of control limits due to matrix interference. Sample results may be biased.
- N See Case Narrative on page 2 of report.
- Q Initial calibration verification (ICV), continuing calibration verification (CCV) or laboratory control sample (LCS), and/or matrix spikes exceeded high recovery limits, but associated samples are non-detect and the sample results are not affected. Data meets EPA/NELAP requirements.
- R Relative percent difference (RPD) is outside of the accepted recovery limits.
- R1 The numerical difference between the parent sample and the duplicate (DUP) is outside of the accepted recovery limits. Greater than 5 degrees for Flashpoint, or greater than 0.1 pH units for pH.
- R3 The relative percent difference (RPD) and/or percent recovery for the duplicate (DUP) or matrix spike (MS)/matrix spike duplicate (MSD) cannot be accurately calculated due to the concentration of analyte already present in the sample.
- R4 The Relative percent difference (RPD) is not within control limits because the concentration of the sample result is too low to represent proper statistical error.
- R5 The difference between the BOD/CBOD results for the highest and lowest dilution used for the calculation is >30% because the results are too low to represent proper statistical error. The BOD/CBOD sample result is an average of all qualified bottles for each dilution series. The sample results are not affected.
- R6 The difference between the BOD/CBOD results for the highest and lowest dilution used for the calculation is >30%. This may indicate a possible matrix interference. The BOD/CBOD sample result is an average of all qualified bottles for each dilution series.
- S Surrogate and/or matrix spike recovery is outside of the accepted recovery limits. Sample results may be biased.
- S1 Surrogate or matrix spike recovery is outside of control limits due to dilution necessary for analysis.
- SC Sub-contracted to another laboratory for analysis.
- SP Sample(s) were not collected per EPA Method 5035A protocols. The results are considered minimum values.
- * Value exceeds Maximum Contaminant Level or is outside the acceptable range.<<>>